

Service-Information Motorcycle



BMW of N.A.
Service Department

Group: 16

December, 1986

Fuel Tank & Lines

16 014 86
(2231)

For USA Only

Fuel Filter - All K Models

COMPLAINT: Hard starting, continued cranking of engine with the electric starter in order to start.

CAUSE: A crack in the fuel filter housing which results in a drop in fuel pressure. The crack was due to the manufacturer's numbers being stamped into the side of the housing.

REMEDY: A new fuel filter with a thicker housing has been introduced, and the manufacturer's numbers are now printed with an ink stamp.

PART NO: 13 32 1 461 265

Very truly yours,

BMW OF NORTH AMERICA, INC.

Richard Dampf
National Technical Manager
Motorcycle Group

RD:jel