

Service-Information Motorcycle



BMW NA
Service Department

Group: 46
Frame


May 1995
46 047 95
(2673)
Page 1 of 3

For USA Only

Side Stand, all K Models, & R 1100 Models

Reminder: As outlined in the "Warranty Information Service History" booklet we recommend "Check and adjust side stand retraction linkage or check function of electric side stand switch (angle)." The first part of the statement applies to K models (2-valve) with retraction linkages and the second part applying to K 4 valve models, & R 1100 models, which have side stand cut off switches.


In some cases all that is needed is cleaning, lubricating, and check that it works correctly. However if these items have not seen regular service, then some replacement parts may be needed as well. Please review the drawings below.

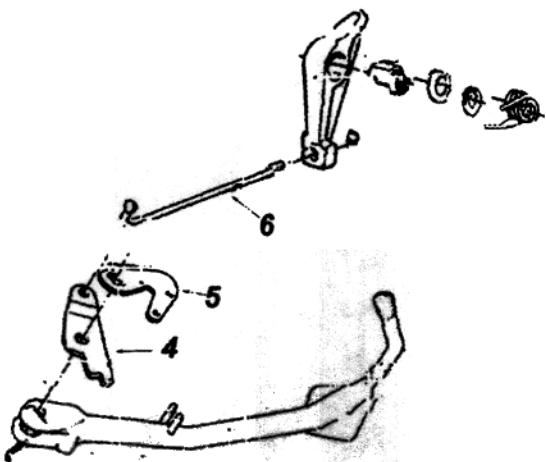


The above drawing is of the K 2 valve model, if after cleaning, lubricating, and adjusting it does not work correctly-check # 4, # 5, and # 6 for stretching and/or distortion. Correct as needed.

Please initial and route to the following before filing

Service	Parts	Sales	Warranty	Technicians		

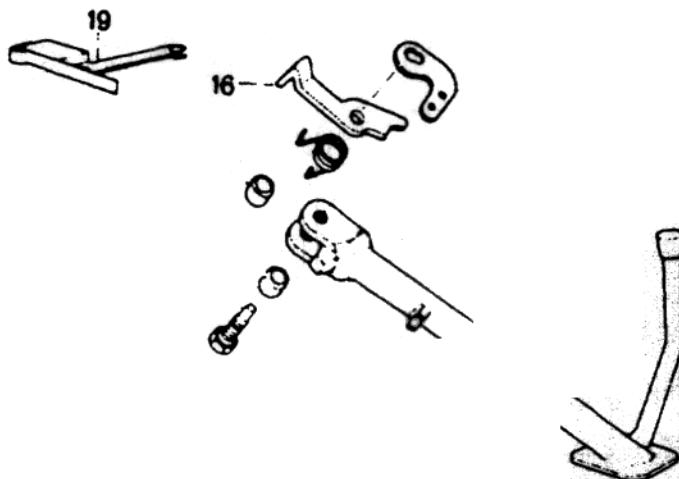

The above drawing is a K 4 valve model. If after cleaning, lubricating, and adjusting it does not work correctly - check # 16, and #19 for stretching and/or distortion. Correct as needed.

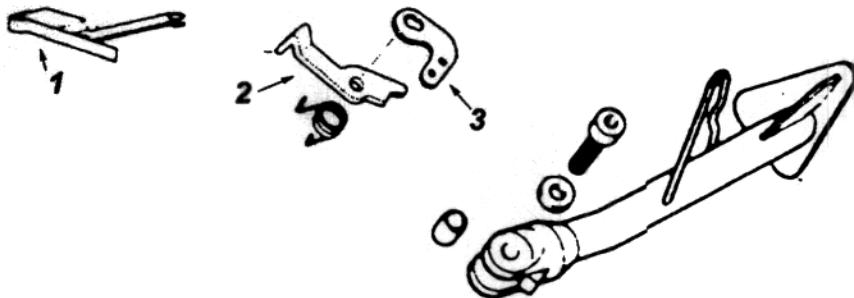

The above drawing is a R 1100 model. If after cleaning, lubricating, and adjusting it does not work correctly-check # 1, # 2, and # 3 for stretching and/or distortion. Correct as needed.

Note: If the side stand bolt has been loosened/removed, please ensure you use Loctite # 242 and torque to specification below:

K 2 valve	41 Nm	(30 Ft. Lb.)
K 4 valve	41 Nm	(30 Ft. Lb.)
R 1100	41 Nm	(30 Ft. Lb.)

BMW of North America, Inc.

F. Stevens
(KF)

Frank Stevens
Manager - Motorcycle Operations
Motorcycle Group

D. E. Browning

Daniel E. Browning
National Technical/Training Manager
Motorcycle Group